





	t_{fix} d_f	HDA-P/PF/PR	max t_{fix} [mm]	d_f [mm]
HDA-P/PF/PR M16 x 190/40		HDA-P/PF/PR M16 x 190/40	40	18
HDA-P/PF/PR M16 x 190/60		HDA-P/PF/PR M16 x 190/60	60	18

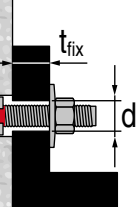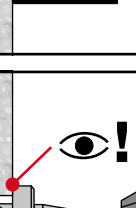
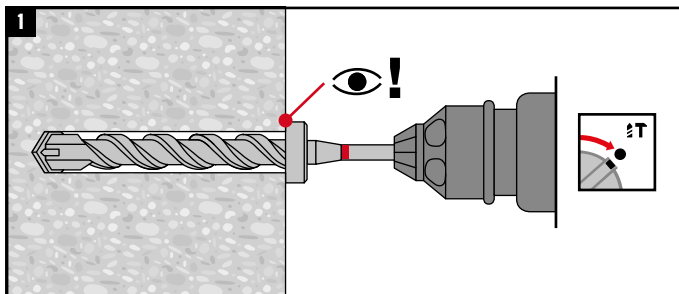
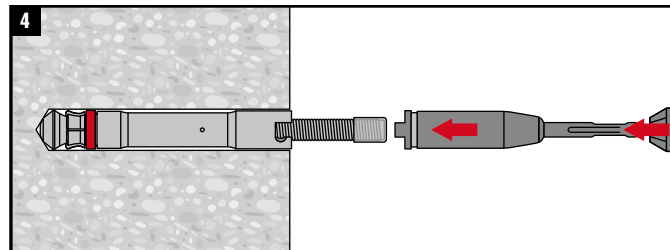
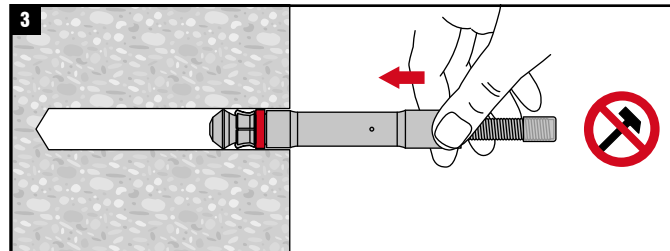


HDA-P/PF/PR	TE-Y (SDS max)
HDA-P/PF/PR M16 x 190/40	TE-Y-HDA-B 30 x 190
HDA-P/PF/PR M16 x 190/60	TE-Y-HDA-B 30 x 190


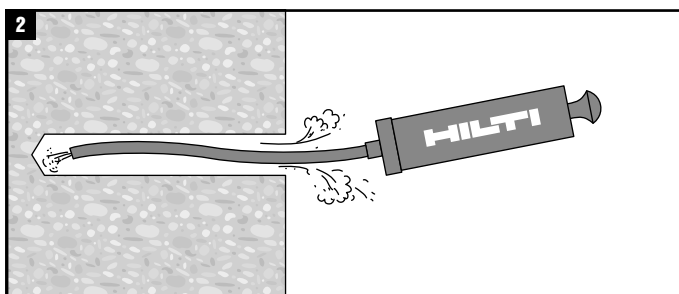


HDA-P/PF/PR	TE-Y (SDS max)
HDA-P/PF/PR M16	TE 70, TE 75, TE 76, TE 80

HDA-P/PF/PR	TE-Y (SDS max)
HDA-P/PF/PR M16	TE-Y-HDA-ST30-M16

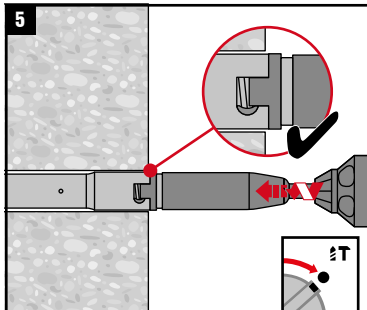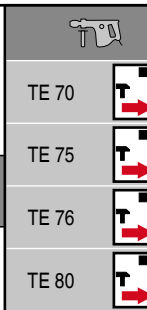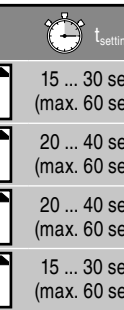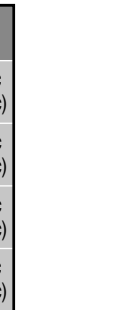5		$t_{setting}$
	TE 70	15 ... 30 sec (max. 60 sec)
	TE 75	20 ... 40 sec (max. 60 sec)
	TE 76	20 ... 40 sec (max. 60 sec)
	TE 80	15 ... 30 sec (max. 60 sec)

With TE 70: $h_{min} \geq 300$ mm (11.8 in) for HDA-P(PR) M16

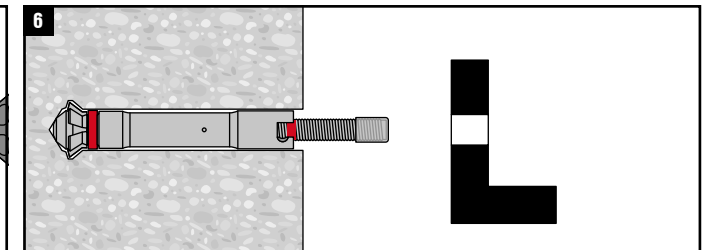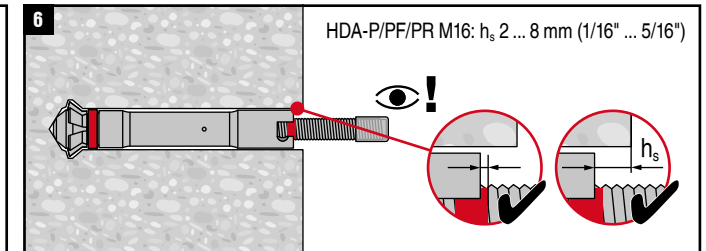

HDA-P/PF/PR	SW	T_{inst}
HDA-P/PF/PR M16	24	120 Nm (89 ft-lb)

7

